

Drying Log Report


Claim Information

Insurance Company : Sample Insurance of Florida
 Adjuster : Brian Smith
 ClaimNumber : SIF-359801
 Insured : Patti G.
 Address : 3453 Blue Pine Way
 City : Jacksonville State : FL Zip : 32225
 Cause of Loss : Supply - Toilet

Project Information for Water Damage Area


Square feet :	1076	Project Start Date :	11/11/2008
Cubic feet :	12833	Project End Date :	11/17/2008
Linear feet :	354	Project Duration :	6 day(s)
Number of Enclosures :	8	Missing Visits :	1 visit(s)
Damage Class :	Class 2	Recommended Project Duration :	5
Water Category :	Category 1 - Clean	MC Goal Floors :	15.00
		MC Goal Walls :	15.00

Psychrometric Monitoring Information

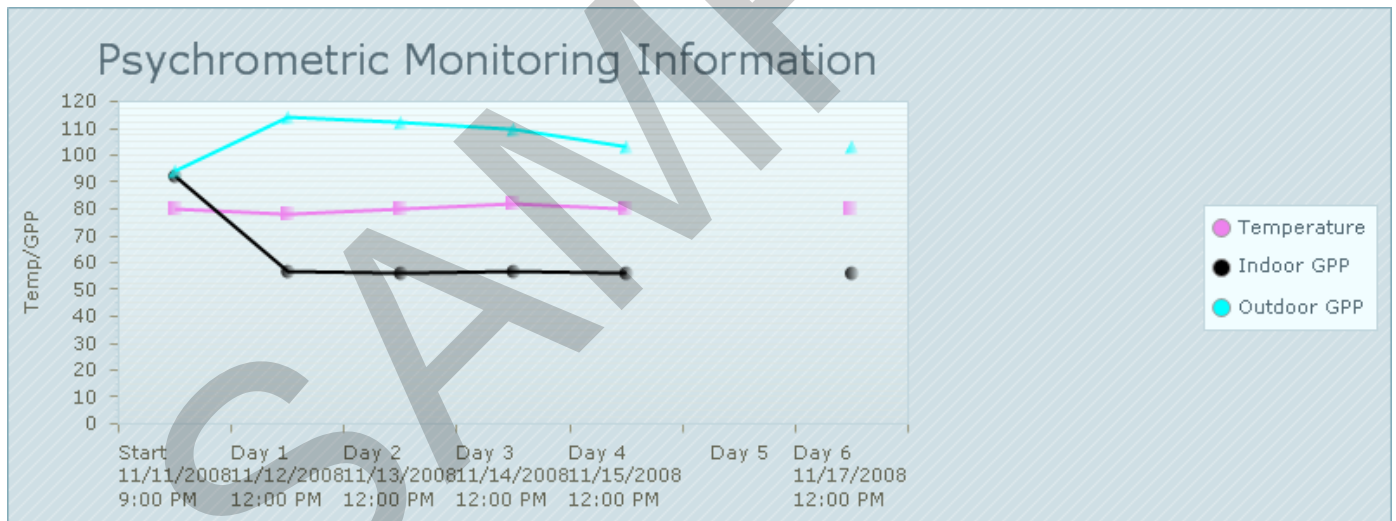


- 1 Contractor missed 1 daily monitoring visit(s) to reposition equipment. This lack of daily air mover repositioning may have lengthened the project duration.
- 2 Indoor air temperature was ideal to promote substrate drying with a range of 78 to 82.
- 3 Based on specific humidity (GPP) information, ambient air conditions were ideal to promote substrate drying. Excluding the first visit, GPP ranged from 56 to 57 during the project.

Dehumidifier and Air Mover Information

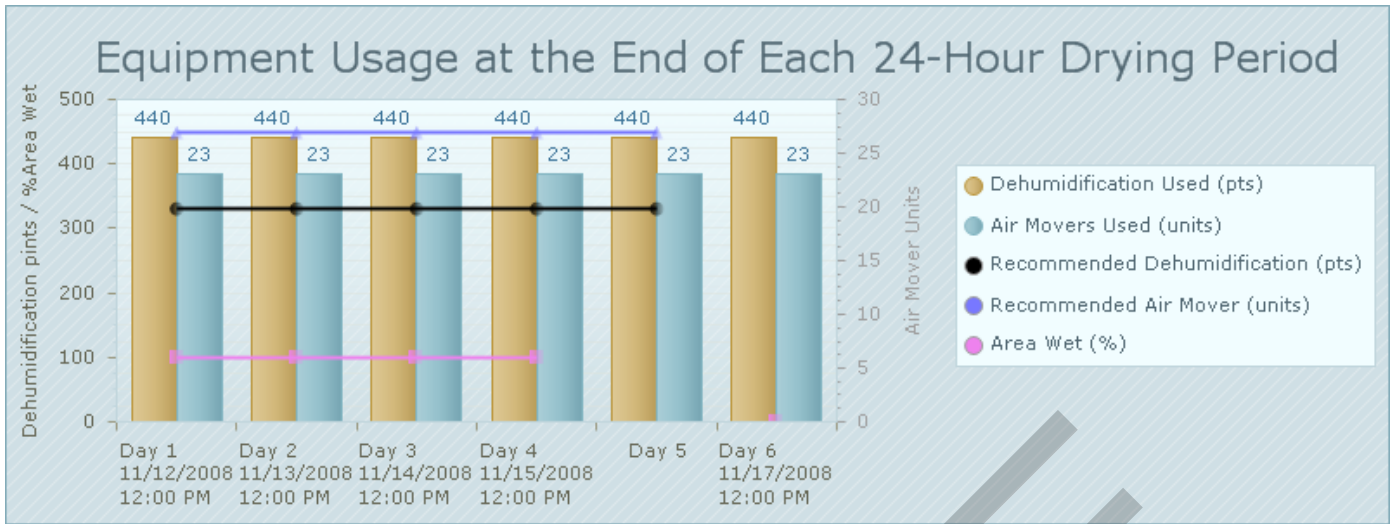

- 4 Based on linear feet of wall in the water damaged area, the recommended air mover usage was 27 units.
- 5 Initial daily air mover usage was 23 units and daily usage remained constant during the project.
- 6 Based on available equipment, the recommended initial daily dehumidification capacity was 330 pints using a 3 DrizAir 2000 unit(s).
- 7 Initial daily dehumidification capacity was 440 units and ranged from 440 to 440 pints. Dehumidification capacity exceeded recommended capacity by greater than 10% on 5 visit(s) of the 6 day project.

Substrate Moisture Content Information

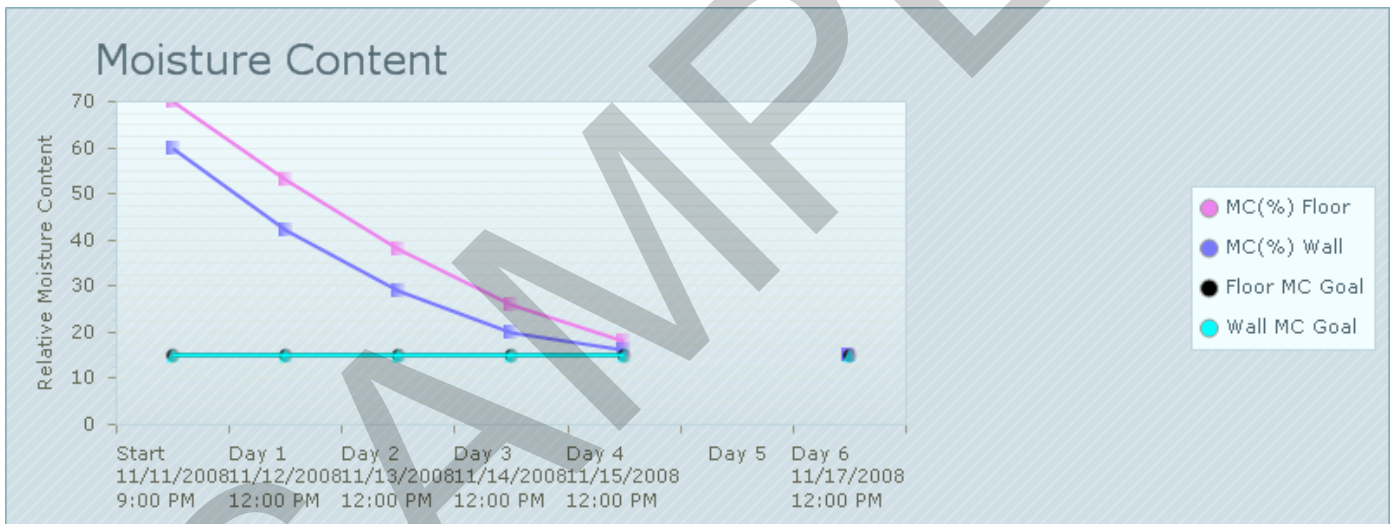

- 8 The drying project was satisfactorily completed on Visit 6 but there was 1 missed monitoring visit(s) for equipment repositioning during the 6 day project. Therefore, the equipment rental period should not exceed 5 days.

Contractor Notes	Visit#	Contractor	Date Created
No records to display			

Note: Any user of the information contained in this Report uses it at their own risk. There is no guarantee that the information contained herein is free from error. The information is calculated based on supplied data. To the extent that the such data is inaccurate, or there are changes in the environmental conditions that are not included in the input data, e.g. changes in air temperature or relative humidity levels, the report will be inaccurate.